IBM Cloud Object Storage System 3.16.1

Release Notes





### **Contents**

Support information	iv
Chapter 1. New Features and Improvements in ClevOS	3.16.1
Chapter 2. New Features and Improvements in ClevOS	3.16.02
Chapter 3. Interface Modifications	3
Chapter 4. Resolved Issues	5
Resolved issues in 3.16.1 Resolved issues in 3.16.0	
Chapter 5. Product Alert Notifications	6
Chapter 6. Known issues	7
Upgrading and Installation	
Container	
Alerting and ReportingSystem Behavior	
Storage Pools	
Data Evacuation	
System Configuration	
Deleting objects	
Manager Web Interface	
Vaults	
Vault Mirrors	
Vault migration	11
Chapter 7. Supported Hardware Platforms	12
IBM Cloud Object Storage Appliances	
Hewlett Packard Enterprise	
Seagate	
Cisco	
Dell	13
Lenovo	
Quanta Cloud Technology (QCT)	
Chapter 8. Incompatible Hardware and Firmware with	ClevOS 15
Broadcom	
Hewlett Packard	
IBM Cloud Object Storage Appliances	
Seagate	
Supermicro	
Notices	17
Tradomarks	19

### **Support information**

Technical support contacts.

For more information on the product or help with troubleshooting, contact IBM Support at <a href="mailto:ibm.com/">ibm.com/</a> mysupport or visit the Directory of worldwide contacts.

# **Chapter 1. New Features and Improvements in ClevOS 3.16.1**

No new features in this release.

# **Chapter 2. New Features and Improvements in ClevOS 3.16.0**

# Expiration Lifecycles for Versioned Objects and Incomplete Multipart Uploads in Container Mode (1697)

The ClevOS system currently allows users to easily manage stale data by configuring expiration lifecycle on a bucket. This system only supported regular (non-versioned) objects in the past, disallowing users from enabling expiration on versioning-enabled container vaults (and vice versa). This feature extends object expiration to include versioned objects and incomplete multipart uploads. Users with versioned buckets and work flows that create incomplete MPUs can now take advantage of expiration lifecycle to manage their usage.

#### **Chapter 3. Interface Modifications**

## API updates for ClevOS 3.15.7 have been referenced in the following documentation:

- REST API Developer Guide
- Cloud Storage Object (CSO) API 2.5 Developer Guide

# API updates for ClevOS 3.15.1 have been referenced in the following documentation:

- · Container Mode Service API Guide
- CSO API 2.5 Developer Guide
  - COS-71196, hard quota support for buckets was originally added as part of F1342 (update to Service API). In the course of development for F1616, the following fix was added. First, it was found that the response when the hard quota is exceeded was using vault mode terminology. As part of the fix, the <Code> and <Message> fields were updated to the output below.

# API updates for ClevOS 3.15.0 have been referenced in the following documentation:

• REST API Developer Guide

## API changes for ClevOS 3.14.13 have been referenced in the following documentation:

- Cloud Storage Object API 2.5 Development guide (COS-76460/COS-76461)
  - PUT ACL for an Object in the Versioning Enabled bucket, with a non-existent version returned a 404 error code. However no information was included in the error code, message, and field. New behavior is updated to include the following fields as part of the response:

Error code: NoSuchVersion

Error message: The specified version does not exist.

Extra fields: <Key>object name</Key><VersionId>requested version id</VersionId>

PUT/GET ACL for an Object with VersionId which has a delete marker returned a 404 error code.
 New behavior is updated to return a 405 error code with the below fields as part of the response.

Error code: MethodNotAllowed

Error message: The specified method is not allowed against this resource.

Extra fields: <Method>method</Method><ResourceType>DeleteMarker</ResourceType>

• Cloud Storage Object API 2.5 Development guide (COS-73284)

New behavior is updated to include the header x-amz-version-id in the response for a PUT object for a version enabled bucket only when the versioning mode is ENABLED. Previously, the x-amz-

version-id header was included with a value of "null" in the PUT Object response when the versioning mode was SUSPENDED. This behavior is updated and the x-amz-version-id header is not included in the response.

New behavior is updated to include header x-amz-delete-marker with a value of "true" to be returned for GET/HEAD/DELETE object operations only when the object has a delete marker.

GET/HEAD for an Object in the Versioning Enabled bucket, with a non-existent version returned a 404 error code. However no information was included in the Error code, message and field. New behavior is updated to include the following fields as part of the response.

Error code: NoSuchVersion

Error message: The specified version does not exist.

Extra fields: <Key>object\_name</Key><VersionId>requested\_version\_id</VersionId>

 GET/HEAD for an Object with VersionId which has a delete marker returned a 404 error code. New behavior is updated to return a 405 with the below fields as part of the response.

Error code: MethodNotAllowed

Error message: The specified method is not allowed against this resource.

Extra fields: <Method>method</Method><ResourceType>DeleteMarker</ResourceType>

GET/HEAD for an Object in the Versioning Suspended bucket using the versionid=null returned a 404 error code. New behavior is updated to return the object if present and return a 200 error.

### **Chapter 4. Resolved Issues**

#### Resolved issues in 3.16.1

Table 1. Resolved	d issues
Issue	Description
	Nothing to report.

#### Resolved issues in 3.16.0

Table 2. Resolved issues	
Issue	Description
Nothing to report.	

### **Chapter 5. Product Alert Notifications**

IBM® clients with an IBM ID may sign up to receive product alert notifications that contain important information that may impact the use of the IBM Cloud Object Storage System™. In order to receive these notifications, clients need to subscribe to the "IBM Cloud Object Storage System™ product in MyNotifications. The table below represents the alert notifications that are applicable while running this latest version of ClevOS at the time of this release note publication. For any questions regarding the content of these product notifications, contact IBM Support.

Table 3. Product Alert Notifications for the IBM Cloud® Object Storage System		
Alert Notification Title	Impacted ClevOS <sup>™</sup> Releases	Alert Notification Published Date
Slicestor® disks may unexpectedly transition to a DIAGNOSTIC state.	ClevOS 3.15.3 and future releases	Sep 10, 2021
Performance implications of non- homogenous COS storage pool expansions	All ClevOS releases	Jun 30, 2021
API changes related to S3 Object Versioning	3.15.7 and future releases	Apr 19, 2021
Issue with adding multiple drives in a IBM COS Slicestor® appliance	All ClevOS releases	Jul 20, 2020
A firmware issue can cause IBM COS Gen2 HW nodes to fail to boot up	ClevOS independent	Jun 18, 2020
Java <sup>™</sup> version incompatibility preventing IPMI access	ClevOS independent	Mar 12, 2018
IPMI Configured via nut Command Does Not Persist on Device Restart	ClevOS independent	Jun 27, 2017
Drive-managed Shingled Magnetic Recording (SMR) drives are not approved and should not be used with named-object protocol workloads	ClevOS independent	Mar 16, 2017
IBM COS Slicestor® 2584 Fails to Attach Drives	ClevOS independent	Feb 2, 2017

# **Chapter 6. Known issues**

Issue	Failing Condition	Disposition
COS-58128	DLM cannot process more than 16 hot-swap events at once.	This issue will be fixed in a future release.
COS-50579	There is a known issue where slice data being reallocated from one Slicestor device to another would not be appropriately removed from the source Slicestor device if the reallocation process was erroneously marked as complete."	This issue still exists in 3.14.3 because the change was reverted the latest fix.
COS-11201	In the Event Console of the Manager User Interface, the event details section for failing disk migration events contains a parameter that is called Migration Progress. However, it is not clear what this value represents.	This value corresponds to the percentage of failing disk migratio that is complete.
COS-11355	Replacing a failed drive with another failed drive results in an inconsistent view on the Manager User Interface. On the Monitor Device page, in the "Summary of device health" section, both the replaced failed drive and the new failed drive are shown. The "Drive Information and Actions" view of the drive layout shows the replaced failed drive. On the Maintenance page, the FRU report contains the replaced failed drive.	Perform another replacement of the failed drive with a good drive.
COS-13575	The "stop migration" operation for failing disk migration on the Manager User Interface (UI) can take ~20 seconds to complete after being initiated by the user. The button continues to be enabled during this time. This issue exists for dispose and reset disk operations as well.	Do not hit the button again until the operation completes. If the drive stays in the same state for more than 20 seconds, perform a refresh of the page. If the drive continues to stay in this state, follow the recommended action that is provided in the Manager Administration Guide under disk lifecycle management.
COS-10031	When resuming a drive in the DIAGNOSTIC state from the Manager User Interface, it can take ~20 seconds to complete. The resume button is not disabled during this time.	Do not hit the resume button unt the operation completes. If the dri stays in the DIAGNOSTIC state for more than 20 seconds, perform a refresh of the page. If the drive continues to stay in this state, follow the recommended action that is provided in the Manager Administration Guide under disk lifecycle management.

Issue	Failing Condition	Disposition
COS-10445	When using the storage command from the localadmin shell on a Slicestor® device, it is possible to resume all drives that are currently in the DIAGNOSTIC state. However, in some cases, this process can take too long, which will cause the command to return an error code -15 due to a timeout.	Despite the error, the resume process is continuing in the background. The storage list command can be used to monitor the progress of resume process.
COS-7488	When performing a storage pool set removal, it is possible that once the reallocation has finished for a source Slicestor device, it can show some small amount of data still present.	No action is required. Once the se removal has completed, all slices have been reallocated to the new storage pool. Any discrepancy in a Slicestor device's used space is generally a result of small inaccuracies that can occur during normal usage of the system.
COS-13504	When failing a quarantined drive, it is possible that after data has been migrated off the failing drive, the Manager event console will report that no data migration was attempted.	No action is required. Despite the event description, data migration will always be attempted unless the user specifically chooses to skip migration via the localadmin shell storage command.
COS-22990	The S3 remote proxy implementation of vault proxy has a few limitations that are related to communicating with an Amazon S3 endpoint. The version of the AWS SDK used to communicate to Amazon defaults to using V2 instead of V4 authentication, causing authentication issues when communicating with certain AWS endpoints.	For further assistance in configurion a remote proxy for use with Amazon S3, contact IBM customer support
COS-23962	Vault quotas are static and do not update when storage pool capacities change. If a system expansion, set replacement, or set removal is performed on the storage pool, vault quotas for any vaults on that pool will not update to consider the new capacity.	The user-defined vault quotas wo as expected. However, they cannot be consistent with the current storage pool capacity. For exampl a vault quota can be higher than total storage pool capacity after set removal.
COS-29681	When using the Microsoft IE9 web browser, certain Manager user interface elements like the left navigation panel and the vault capacity bar charts on the Monitor Vault page cannot appear.	Microsoft has ended support of IE and IE10. Users should upgrade t Microsoft IE11 or higher, or use a alternative browser, such as Firefo Safari, or Chrome.
COS-64358	If an Accesser device restarts during a cycle, a small number of object deletions may be delayed up to 72 hours.	This issue will be fixed in a future release.

### **Upgrading and Installation**

Table 5. Upgrading and Installation		
Issue	Failing Condition	Disposition
	Nothing to report	

#### **Container**

Table 6. Container		
Issue	Failing Condition	Disposition
COS-1852	When attempting to write an object to a container that does not exist, the Accesser® appliance returns an HTTP 404 response with an error message of NoSuchKey instead of the appropriate NoSuchBucket. This includes cases where the container name includes a "/".	Ensure that your vault or container is successfully created before attempting to write objects to it. If you receive an error message of NoSuchKey for an upload request, verify that the container you are addressing does exist.
COS-15401	If a user attempts to create a management vault by using "manual configuration" (accessed through the Configure Management Vault page) based on an existing vault template, management vault creation fails with the following message: "Cannot create a management vault from this template. It is deployed to access pools with standard vaults"	Use the "automatic configuration" available on the Configure Management Vault page.

### **Alerting and Reporting**

Table 7. Alerting and reporting		
Issue	Failing Condition	Disposition
	Nothing to report.	

#### **System Behavior**

Table 8. System behavior		
Issue	Failing Condition	Disposition
COS-2498	The usage of a disk is counted while the disk is offline. However, its capacity is not counted.	No action. Awareness of limitation. If necessary, a restart of core would fix the usage values. Limit DLM events.

#### **Storage Pools**

Table 9. Storage p	able 9. Storage pools		
Issue	Failing Condition	Disposition	
COS-2642	On the *Monitor Storage Pool Page, the <b>Reallocation Progress</b> graph, which displays historical data, is inaccurate when a device is down or statistics are not collected for a window of time.	The <b>Data Reallocation</b> progress bar, available at the top of the *Monitor Storage Pool Page, is always accurate. This view reflects the status and should be used to monitor progress of the data reallocation activity.	

#### **Data Evacuation**

Table 10. Data evo	ıcuation	
Issue	Failing Condition	Disposition
	Nothing to report.	

### **System Configuration**

Table 11. System configuration			
Issue	Failing Condition	Disposition	
	Nothing to report.		

### **Deleting objects**

Table 12. Deleting objects			
Issue	Failing Condition	Disposition	
	Nothing to report.		

#### **Manager Web Interface**

Table 13. Manager Web Interface			
Issue	Failing Condition	Disposition	
COS-10031	When resuming a drive in the DIAGNOSTIC state from the Manager User Interface, it may take ~20 seconds to complete. The resume button is not disabled during this time.	Do not hit the resume button until the operation completes. If the drive stays in the DIAGNOSTIC state for more than 20 seconds, perform a refresh of the page. If the drive continues to stay in this state, follow the recommended action that is provided in the Manager Administration Guide under disk lifecycle management.	

Table 13. Manager Web Interface (continued)			
Issue	Failing Condition	Disposition	
COS-23764	Upon network failure while going through the one time setup process in the manager, a network error page appears. When the network comes back, reload the page, at which point an internal server error page appears in some scenarios.	Log out of the internal server error page and log back into the manager, which will take you through one time setup again.	

#### **Vaults**

Table 14. Vaults		
Issue	Failing Condition	Disposition
	Nothing to report	

#### **Vault Mirrors**

Table 15. Vault mirrors			
Issue	Failing Condition	Disposition	
COS-7019	When performing IO against a vault mirror with synchronous writes disable, HEAD requests performed against a successfully written object may return an HTTP 404 response.	If an HTTP 404 is returned for a HEAD request for a recently written object, please retry your request.	

### **Vault migration**

Issue	Failing Condition	Disposition
COS-12442	When a vault migration finishes the work that is contained in its TODO queue, it kicks off a process to calculate the exact count of the number of objects that are migrated as part of the migration. This process of calculating the exact size is performed by each device in the target pool, and can take a long time to complete for large migrations.	

### **Chapter 7. Supported Hardware Platforms**

#### **IBM Cloud Object Storage Appliances**

Table 17. Minimum Version of ClevOS Compatible with IBM Hardware Platforms				
Product Name	Machine Type (1Yr/3Yr Warranty)	Model	Minimum ClevOS	
IBM COS Accesser® 3105	3401/3403	A00	3.8.1	
IBM COS Accesser® 4105	3401/3403	A01	3.8.1	
IBM COS Accesser® 3110	4958/4957	A10	3.14.4	
IBM COS Manager <sup>™</sup> 3105	3401/3403	M01	3.8.1	
IBM COS Manager™ 3110	4958/4957	M10	3.14.4	
IBM COS Slicestor® 2212	3401/3403	S00	3.8.1	
IBM COS Slicestor® 2448	3401/3403	S01	3.8.1	
IBM COS Slicestor®3448	3401/3403	S02	3.8.3	
IBM COS Slicestor®2584 (AP-TL-1)	3401/3403	S03	3.8.1	
IBM COS Slicestor®2584 (AP-LS-1)	3401/3403	S03	3.13.1	
IBM COS Slicestor®2212A	3401/3403	S10	3.10.0	
IBM COS Slicestor®12	4958/4957	C10/J10	3.14.4	
IBM COS Slicestor®53	4958/4957	C10/J11	3.14.4	
IBM COS Slicestor®106	4958/4957	C10/J12	3.14.4	
IBM COS Slicestor®92IBM Cloud Object Storage System™	4958/4957	C10/J15	3.15.5	

Note: 🛘 Requires RPQ

#### **Hewlett Packard Enterprise**

Table 18. Minimum Version of ClevOS Compatible with Hewlett Packard Enterprise Hardware			
Appliance	Model	Minimum ClevOS	
Manager Appliance	DL360P Gen8	3.2.1	
Manager Appliance	DL360 Gen9	3.5.0	
Manager Appliance	DL380 Gen9	3.5.0	
Accesser® Device	DL360P Gen8	3.2.1	
Accesser® Device	DL360 Gen9	3.5.0	
Accesser® Device	DL380 Gen9	3.5.0	
Slicestor® Device	SL4540 Gen8	2.9.0	
Slicestor® Device	DL380 Gen9	3.5.0	

Table 18. Minimum Version of ClevOS Compatible with Hewlett Packard Enterprise Hardware (continued)			
Appliance	Model	Minimum ClevOS	
Slicestor® Device	Apollo 4200 Gen9	3.6.0	
Slicestor® Device	Apollo 4510 Gen9	3.6.0	
Slicestor® Device	Apollo 4510 Gen10	3.14.0	
Slicestor® Device	Apollo 4530 Gen9	3.6.0	

### Seagate

Table 19. Minimum Version of ClevOS Compatible with Seagate Hardware			
Appliance Model Minimum ClevOS			
Seagate OneStor® AP-2584 1 AP-TL-1 3.4.2			
Seagate Exos® AP 5U84-Laguna Seca 3.15.0			

#### Cisco

able 20. Minimum Version of ClevOS Compatible with Cisco Hardware			
Appliance	Model	Minimum ClevOS	
Cisco Slicestor® Device	UCS C3260	3.7.4	
Cisco Slicestor® Device	UCS S3260 (Single Node)	3.12.0	
Cisco Slicestor® Device	UCS S3260 (Dual Node)	3.12.0	
Cisco Slicestor® Device	UCS S3260 M5 (56 drive configuration)	3.13.1	
Cisco Slicestor® Device	UCS S3260 M5 (60 drive configuration)	3.14.3	
Cisco Manager Appliance	UCS C220 M4	3.12.0	
Cisco Accesser® Device	UCS C220 M4	3.12.0	
Cisco Manager Appliance	UCS C220 M5	3.13.6	
Cisco Accesser® Device	UCS C220 M5	3.13.6	
Cisco Slicestor® Device	UCS C240	3.13.6	

### Dell

Table 21. Minimum Version of ClevOS Compatible with Dell Hardware			
Appliance	Model	Minimum ClevOS	
Dell Slicestor® Device	DSS 7000	3.10.1	
Dell Slicestor® Device	R740xd w/ HDD Support	3.14.1	
Dell Slicestor® Device	R740xd w/ NVMe Support	3.14.2	

#### Lenovo

Table 22. Minimum Version of ClevOS Compatible with Lenovo Hardware			
Appliance	Model	Minimum ClevOS	
Lenovo Manager Appliance	X3550 M5	3.10.1	
Lenovo Accesser® Device	X3550 M5	3.10.1	
Lenovo Manager Appliance	X3650 M5	3.10.1	
Lenovo Manager Appliance	SR630	3.13.6	
Lenovo Accesser® Device	SR630	3.13.6	
Lenovo Slicestor® Device	SR650	3.13.6	

### **Quanta Cloud Technology (QCT)**

Table 23. Minimum Version of ClevOS Compatible with QCT Hardware			
Appliance	Model	Minimum ClevOS	
QCT Manager Appliance	QuantaGrid D51PH-1ULH	3.13.4	
QCT Accesser® Device	QuantaGrid D51PH-1ULH	3.13.4	
QCT Slicestor® Device	QuantaGrid D51PH-1ULH	3.13.4	

# **Chapter 8. Incompatible Hardware and Firmware with ClevOS**

The hardware components running firmware revisions listed below are incompatible with ClevOS due to the possibility of unexpected behavior.

**Note:** If you have any hardware on this list running the firmware revisions listed, please contact L3 support immediately to create an upgrade plan. You can determine your firmware revisions using the Firmware Report that is found under the Maintenance menu.

#### **Broadcom**

Table 24. Broadcom Hardware and Firmware Incompatibility with ClevOS			
Type Model Firmware affected			
RAID Controller	ntroller Broadcom MegaRAID 9361-8i 4.650.00-6121		

#### **Hewlett Packard**

Table 25. HP Hardware and Firmware Incompatibility with ClevOS			
Type Model Firmware affected			
RAID Controller	HP-SL4540 Smart Array	6.64	
iLO	HPE SL4540 Gen 8	2.30	

#### **IBM Cloud Object Storage Appliances**

Table 26. IBM COS Hardware and Firmware Incompatibility with ClevOS			
Туре	Model	Firmware affected	
USM	IBM COS Slicestor®2584 (AP- TL-1) 3401/3403 S03	4.1.7	
ВМС	A3105, A4105, M3105, S2212A, S2448	1.0.125362, 1.0.135362	
ВМС	A10,C10,M10	< .97	
CPLD	A10,C10,M10	< 1818	

#### Seagate

Table 27. Seagate Hardware and Firmware Incompatibility with ClevOS			
Type Model Firmware affected			
HDD	Seagate ST1000NM0033-9ZM173	SN04	

### **Supermicro**

Table 28. Supermicro Hardware and Firmware Incompatibility with ClevOS				
Туре	Model Firmware affected			
ВМС	Supermicro SSG-6048R- E1CR60N	3.60		

#### **Notices**

This information was developed for products and services offered in the US. This material might be available from IBM in other languages. However, you may be required to own a copy of the product or product version in that language in order to access it.

IBM may not offer the products, services, or features discussed in this document in other countries. Consult your local IBM representative for information on the products and services currently available in your area. Any reference to an IBM product, program, or service is not intended to state or imply that only that IBM product, program, or service may be used. Any functionally equivalent product, program, or service that does not infringe any IBM intellectual property right may be used instead. However, it is the user's responsibility to evaluate and verify the operation of any non-IBM product, program, or service.

IBM may have patents or pending patent applications covering subject matter described in this document. The furnishing of this document does not grant you any license to these patents. You can send license inquiries, in writing, to:

IBM Director of Licensing IBM Corporation North Castle Drive Armonk, NY 10504-1785 U.S.A.

For license inquiries regarding double-byte character set (DBCS) information, contact the IBM Intellectual Property Department in your country or send inquiries, in writing, to:

Intellectual Property Licensing Legal and Intellectual Property Law IBM Japan, Ltd. 19-21, Nihonbashi-Hakozakicho, Chuo-ku Tokyo 103-8510, Japan

INTERNATIONAL BUSINESS MACHINES CORPORATION PROVIDES THIS PUBLICATION "AS IS" WITHOUT WARRANTY OF ANY KIND, EITHER EXPRESS OR IMPLIED, INCLUDING, BUT NOT LIMITED TO, THE IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE. Some jurisdictions do not allow disclaimer of express or implied warranties in certain transactions, therefore, this statement may not apply to you.

This information could include technical inaccuracies or typographical errors. Changes are periodically made to the information herein; these changes will be incorporated in new editions of the publication. IBM may make improvements and/or changes in the product(s) and/or the program(s) described in this publication at any time without notice.

Any references in this information to non-IBM websites are provided for convenience only and do not in any manner serve as an endorsement of those websites. The materials at those websites are not part of the materials for this IBM product and use of those websites is at your own risk.

IBM may use or distribute any of the information you provide in any way it believes appropriate without incurring any obligation to you.

Licensees of this program who wish to have information about it for the purpose of enabling: (i) the exchange of information between independently created programs and other programs (including this one) and (ii) the mutual use of the information which has been exchanged, should contact:

IBM Director of Licensing IBM Corporation North Castle Drive, MD-NC119 Armonk, NY 10504-1785 Such information may be available, subject to appropriate terms and conditions, including in some cases, payment of a fee.

The licensed program described in this document and all licensed material available for it are provided by IBM under terms of the IBM Customer Agreement, IBM International Program License Agreement or any equivalent agreement between us.

The performance data discussed herein is presented as derived under specific operating conditions. Actual results may vary.

Information concerning non-IBM products was obtained from the suppliers of those products, their published announcements or other publicly available sources. IBM has not tested those products and cannot confirm the accuracy of performance, compatibility or any other claims related to non-IBM products. Questions on the capabilities of non-IBM products should be addressed to the suppliers of those products.

Statements regarding IBM's future direction or intent are subject to change or withdrawal without notice, and represent goals and objectives only.

All IBM prices shown are IBM's suggested retail prices, are current and are subject to change without notice. Dealer prices may vary.

This information is for planning purposes only. The information herein is subject to change before the products described become available.

This information contains examples of data and reports used in daily business operations. To illustrate them as completely as possible, the examples include the names of individuals, companies, brands, and products. All of these names are fictitious and any similarity to the names and addresses used by an actual business enterprise is entirely coincidental.

#### COPYRIGHT LICENSE:

This information contains sample application programs in source language, which illustrate programming techniques on various operating platforms. You may copy, modify, and distribute these sample programs in any form without payment to IBM, for the purposes of developing, using, marketing or distributing application programs conforming to the application programming interface for the operating platform for which the sample programs are written. These examples have not been thoroughly tested under all conditions. IBM, therefore, cannot guarantee or imply reliability, serviceability, or function of these programs. The sample programs are provided "AS IS", without warranty of any kind. IBM shall not be liable for any damages arising out of your use of the sample programs.

If you are viewing this information softcopy, the photographs and color illustrations may not appear.

#### **Trademarks**

IBM, the IBM logo, and ibm.com® are trademarks or registered trademarks of International Business Machines Corp., registered in many jurisdictions worldwide. Other product and service names might be trademarks of IBM or other companies. A current list of IBM trademarks is available on the web at Copyright and trademark information at www.ibm.com/legal/copytrade.shtml.

Accesser®, Cleversafe®, ClevOS™, Dispersed Storage®, dsNet®, IBM Cloud Object Storage Accesser®, IBM Cloud Object Storage Dedicated™, IBM Cloud Object Storage Insight™, IBM Cloud Object Storage Manager™, IBM Cloud Object Storage Slicestor®, IBM Cloud Object Storage Standard™, IBM Cloud Object Storage System™, IBM Cloud Object Storage Vault™, SecureSlice™, and Slicestor® are trademarks or registered trademarks of Cleversafe, an IBM Company and/or International Business Machines Corp.

Other product and service names might be trademarks of IBM or other companies.

### IBW.

Printed in USA